

Blue

# Work Order ID 53411

November 4, 2009 7:37:27 AM



Page 1

Item ID: D206-667-103TRN

Accept



Setup Start



Revision ID: C

Stop



Item Name: Crosstube Turning DetailL

Start Date: 11/04/09 Start Qty: 1.00



Cust Item ID:

Required Date: 11/06/09 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan:

*BS*

Date: 09-11-11 Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Draw  
Number

Draw  
Rev.

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

Draw Nbr

Revision Nbr

D206-667-143

Rev C

100

0.00



MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA0871 2-Turn first side as per Folio FA0871 3-File down transition lines smooth.

A.M. 09-11-12 ①

110

QC1- Inspect dimensions to dimension sheet

0.00



QC

Memo

0.00

Quality Control

A.M. 09-11-12 ①

120

0.00



MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA0871 2-File down transition lines smooth.  
3-Remove sand and plugs

A.M. 09-11-12 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Work Order ID 53411

November 4, 2009 7:37:27 AM

Page 2

Item ID: D206-667-103TRN

Accept

Revision ID: C

Item Name: Crosstube Turning DetailL

Start Date: 11/04/09 Start Qty: 1.00

Required Date: 11/06/09 Req'd Qty: 1.00

Reference:

Approvals: Process Plan:

Date:

Tooling:

Date:

Run Start

QC:

Date:

SPC (Y/N):

Date:

Stop

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Draw  
Number

Draw  
Rev.

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

130

QC1- Inspect dimensions to dimension sheet

0.00



QC

Memo

0.00

Quality Control

Q.A. 09-11-12 0

140

QC8- Inspect parts - second check

0.00



QC

Memo

0.00

Quality Control

J - - AUM 9-11-12

150

Crosstubes Chemical Conversion

0.00



HandFXtube

Memo

0.00

Hand Finishing Crosstubes

1 - - AUM 9-11-12

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Work Order ID 53411

November 4, 2009 7:37:28 AM

Page 3

Item ID: D206-667-103TRN

Accept

Revision ID: C

Item Name: Crosstube Turning DetailL

Start Date: 11/04/09 Start Qty: 1.00

Required Date: 11/06/09 Req'd Qty: 1.00

Reference:

Approvals: Process Plan:

Date:

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start

Stop

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Draw  
Number

Draw  
Rev.

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

160

QC3- Inspect Part Finish

0.00



QC

Memo

0.00

Quality Control

170

Packaging

0.00



Packaging

Memo

0.00

Packaging

Identify and stock in kanban rack Location: X-TUBE CELL

180

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

1 M 9/11/13

1 - AWM9-11-13

09/11/13

ME 09-11-13

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

November 4, 2009 7:37:26 AM

Page 1

Work Order ID: 53411

Parent Item: D206-667-103TRNRevC

Parent Item Name: Crosstube Turning DetailL

Start Date: 11/04/09

Required Date: 11/06/09

Comments:

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
D6002-115RevA		Manufactured	No			110	Each	64.0000	1.0000			



Crosstube Material



Warehouse

Loc Qty

Loc Code

Location

Main Warehouse

LG

64

34684

4

34776

60

AWM 9-11-09 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



<b>DART AEROSPACE LTD</b>	<b>Work Order:</b>	53411
<b>Description:</b> Crosstube Assembly (206L High Fwd)	<b>Part Number:</b>	D206-667-143
<b>Inspection Dwg:</b> D206-667-143 <b>Rev:</b> B		Page 1 of 1

### FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article
 ☐ Prototype

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.241	/			
	1.982	+0.005/-0.000	1.987	/			
	2.019	+0.005/-0.000	2.023	/			
	2.058	+0.005/-0.000	2.063	/			
	2.097	+0.005/-0.000	2.103	/			
	2.136	+0.005/-0.000	2.138	/			
	2.176	+0.005/-0.000	2.179	/			
	2.201	+0.005/-0.000	2.204	/			
	0.125	+/-0.010	0.125	/			
	0.400 x 30°	+/-0.010	0.400 x 30°	/			
	R0.063	+/-0.010	R0.063	/			
	R0.500	+/-0.010	R0.500	/			
	4.438	+/-0.030	4.438	/			
SIDE B							
	104.98	+/-0.020	105.000	/			
	2.240	+0.005/-0.000	2.240	/			
	1.982	+0.005/-0.000	1.987	/			
	2.019	+0.005/-0.000	2.023	/			
	2.058	+0.005/-0.000	2.063	/			
	2.097	+0.005/-0.000	2.103	/			
	2.136	+0.005/-0.000	2.138	/			
	2.176	+0.005/-0.000	2.183	/			
	2.201	+0.005/-0.000	2.204	/			
	0.125	+/-0.010	0.125	/			
	0.400 x 30°	+/-0.010	0.400 x 30°	/			
	R0.063	+/-0.010	R0.063	/			
	R0.500	+/-0.010	R0.500	/			
	4.438	+/-0.030	4.438	/			

<b>Measured by:</b>	Q.M.	<b>Audited by:</b>	AWM	<b>Prototype Approval:</b>	N/A
<b>Date:</b>	09-11-12	<b>Date:</b>	9-11-12	<b>Date:</b>	N/A


Rev	Date	Change	Revised by	Approved
A	04.05.06	New Issue (P/O D206-667-103)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	

Item	Qty -143	Part Number	Description
1	X	D206-667-143	CROSSTUBE ASSEMBLY (206L HIGH FWD)
2	1	D6002-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2891-1	SUPPORT
6	4	D3595-063-395	RUBBER CUSHION
7	4	MS21920-20	CLAMP (OR MS21920-21)
8	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

**GENERAL NOTES:**

- 1) MATERIAL: MANUFACTURED FROM D6002-115  
FINISHED LENGTH = 104.98±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D206-667-143" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 15.5 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 10 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL M521920-20 CLAMPS (OR -21) WITH D3595-063-395 RUBBER CUSHIONS TO SECURE THE D2891-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS ARE LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.




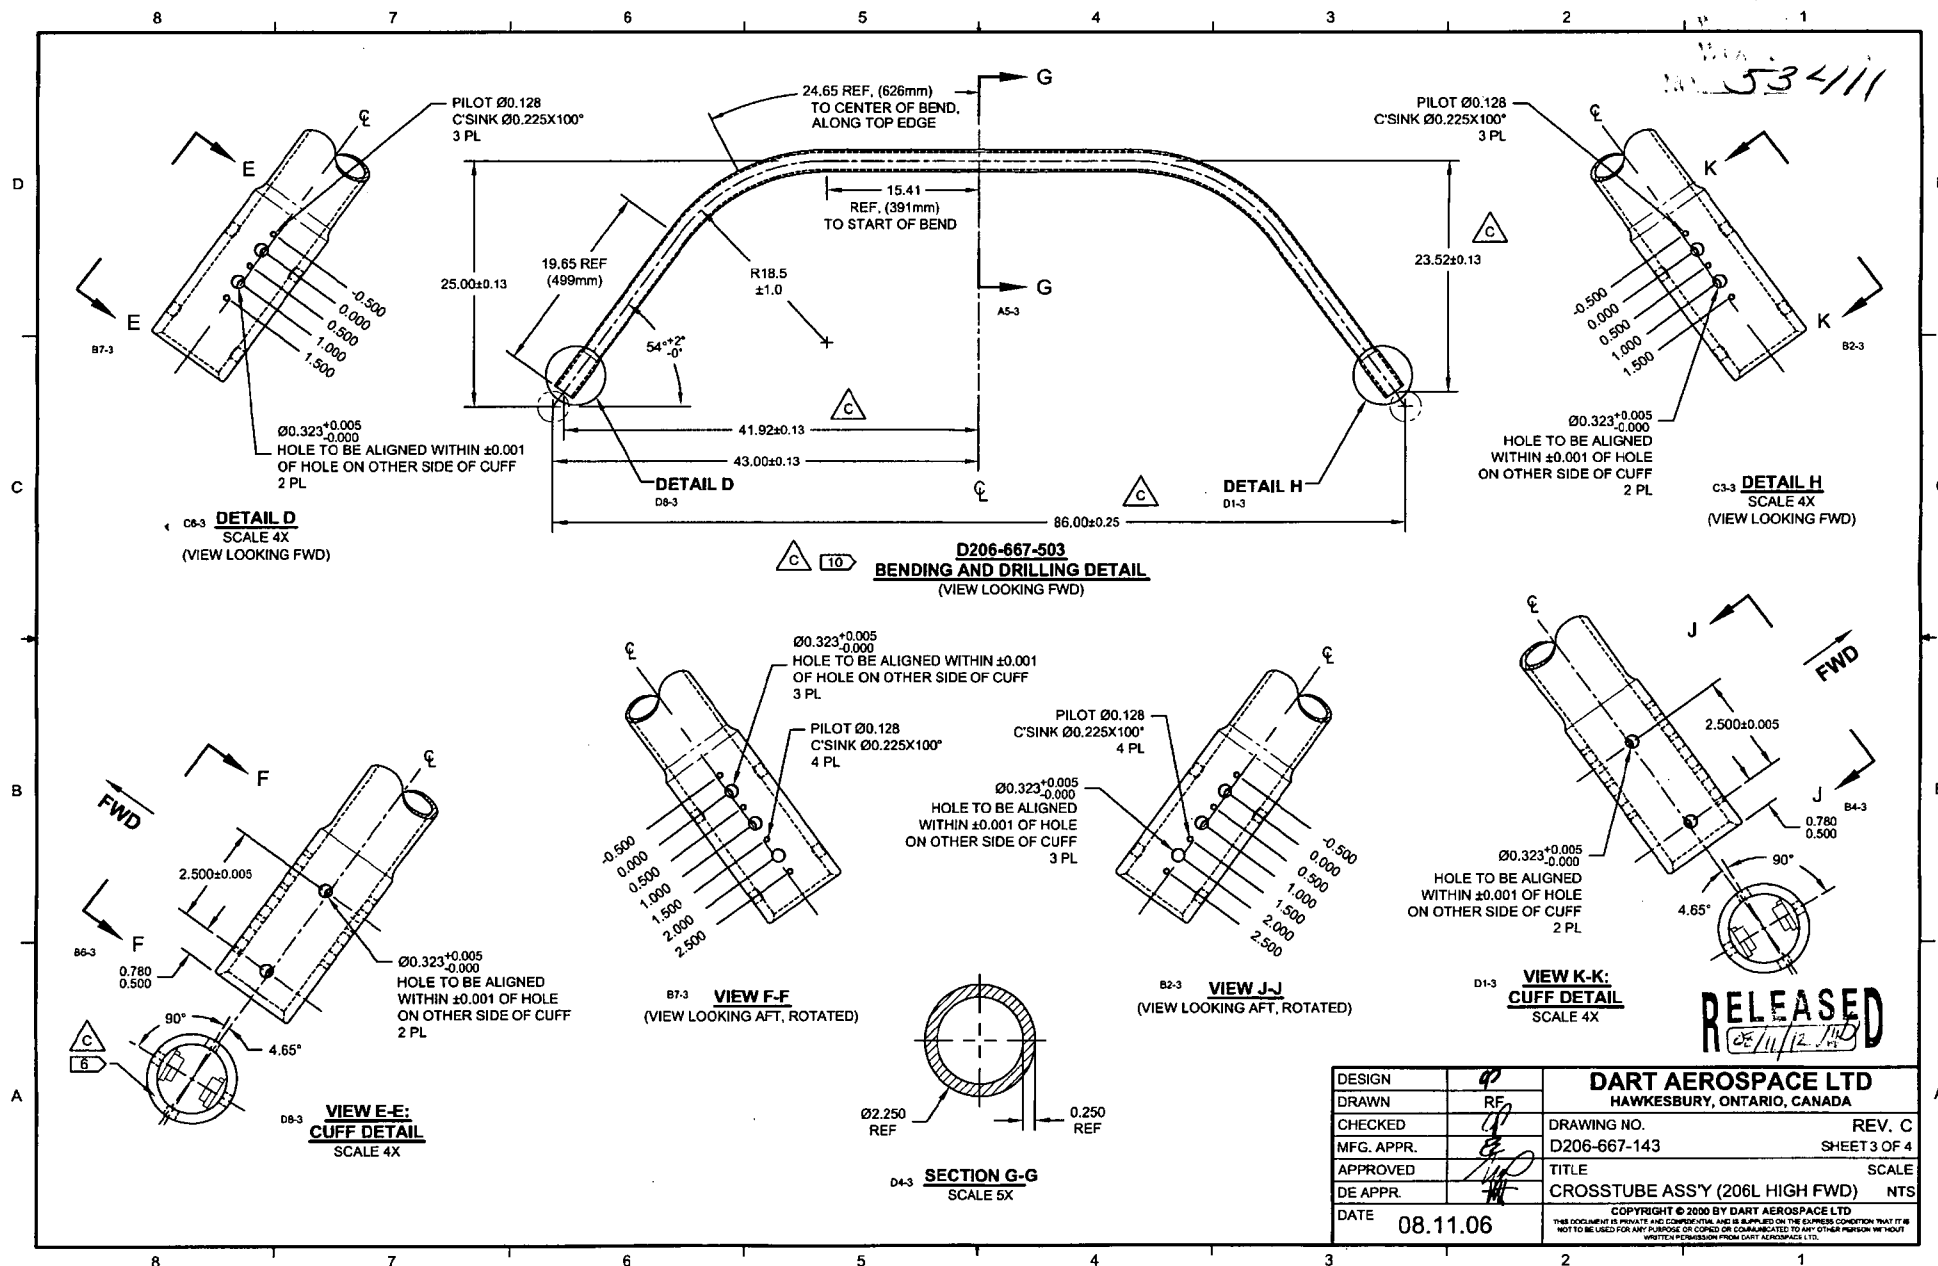




Sheet 1

UNCONTROLLED  
SUBJECT TO  
REVISIONS

NO. 53411

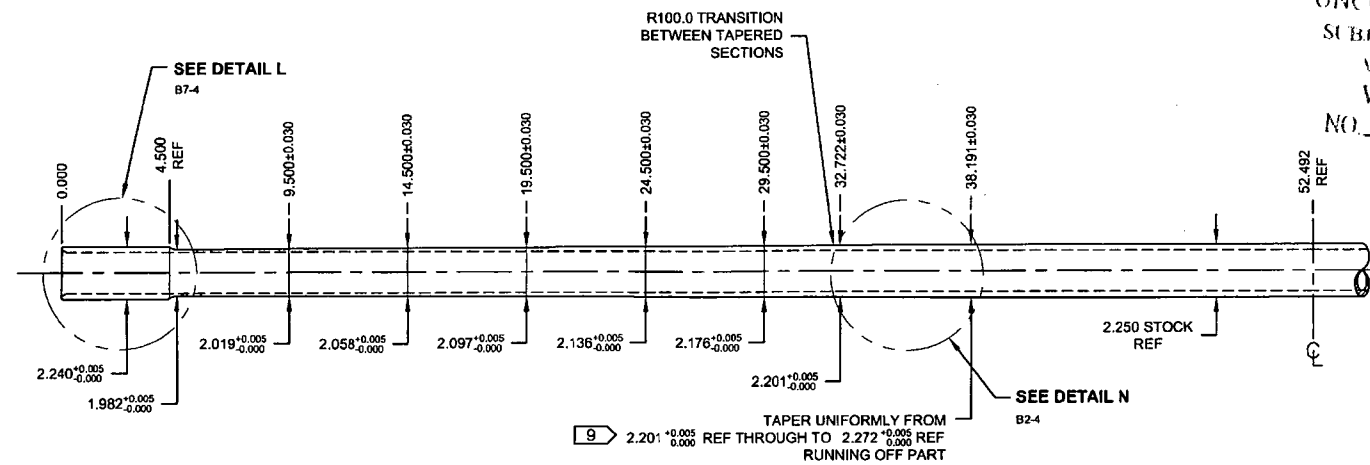

**C TURNING DETAIL**

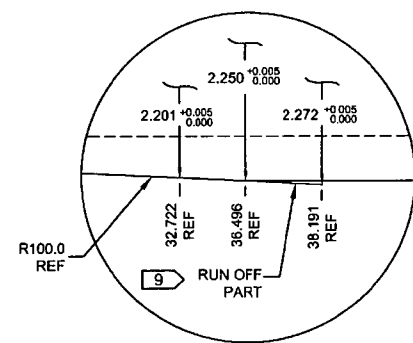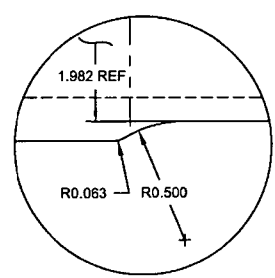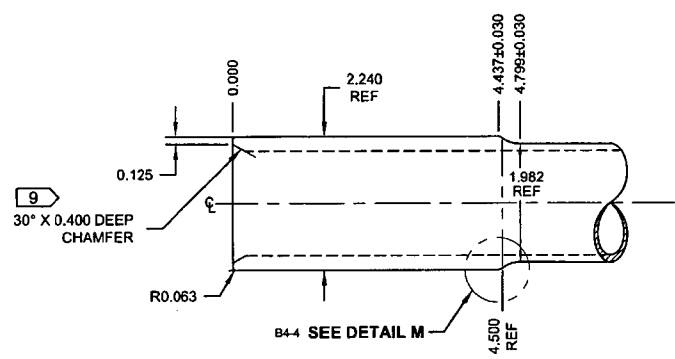

**RELEASED**  
68/11/13

DESIGN	90	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	9	DRAWING NO.	REV. C
MFG. APPR.	9	D206-667-143	SHEET 4 OF 4
APPROVED	9	TITLE	SCALE
DE APPR.	9	CROSSTUBE ASS'Y (206L HIGH FWD)	NTS
DATE	08.11.06	<small>COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	